

YOUR ONE SURVEY  
**HOME REPORT**

---

**ADDRESS**

---

Lismore House  
115 Kelvin Drive  
Glasgow  
G20 8QL

**PREPARED FOR**

---

Ian & Mrs Valerie Atkinson

INSPECTION CARRIED OUT BY:



SELLING AGENT:



HOME REPORT GENERATED BY:



# Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	Glasgow North - Allied Surveyors Scotland Plc	08/04/2021
<u>Mortgage Certificate</u>	Final	Glasgow North - Allied Surveyors Scotland Plc	08/04/2021
<u>Property Questionnaire</u>	Final	Mr. Ian & Mrs Valerie Atkinson	13/04/2021
<u>EPC</u>	Final	Glasgow North - Allied Surveyors Scotland Plc	08/04/2021

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T   1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories  
being rated from 1 to 3.



# Single Survey

Survey report on:

<b>Surveyor Reference</b>	GE/6800
<b>Customer</b>	Mr. Ian & Mrs Valerie Atkinson
<b>Selling address</b>	Lismore House 115 Kelvin Drive Glasgow G20 8QL
<b>Date of Inspection</b>	07/04/2021
<b>Prepared by</b>	Hugh G Campbell, Bsc FRICS Glasgow North - Allied Surveyors Scotland Plc

## SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### **2.4 SERVICES**

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### **2.5 ACCESSIBILITY**

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### **2.6 ENERGY REPORT**

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### **2.7 VALUATION AND CONVEYANCER ISSUES**

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	Detached house, two storey and basement in height with a tower room.
<b>Accommodation</b>	<p>Ground floor: vestibule, entrance hall, sitting room (rear and side), study (front), dining room (front), inner hallway leading to kitchen (rear), with utility room off (rear), w.c apartment (side) off inner hall.</p> <p>First floor: bedroom 1 (rear and side), bedroom 2 (rear) currently used as office, bedroom 3 (front), bedroom 4 (front), bathroom (rear), shower apartment (front).</p> <p>Second floor: tower room accessed from staircase at first floor landing and currently used as artists studio.</p> <p>Basement: self contained flat accessed from external door at left hand gable and also with an internal door connection to the main house; vestibule with cupboard off, entrance hall with boxroom off, lounge (rear), bedroom 1 (rear), bedroom 2 (rear), bedroom 3 (rear), kitchen (side), bathroom (internal).</p>
<b>Gross internal floor area (m<sup>2</sup>)</b>	409 sq mtrs
<b>Neighbourhood and location</b>	The property is located in the North Kelvinside district of Glasgow, lying to the north west of the city centre, on the edge of the Botanic Gardens in Glasgow. The surrounding area is developed with residential property of varying age and character. The property is very conveniently situated for

	all west end facilities include Byres Road and Glasgow University.
<b>Age</b>	The property was built in 1860.
<b>Weather</b>	At the time of inspection it was dry and bright.
<b>Chimney stacks</b>	<p>Chimney stacks are constructed of grey sandstone.</p> <p>Flashings are lead.</p> <p>Visually inspected with the aid of binoculars where required.</p>
<b>Roofing including roof space</b>	<p>About 22 years ago the roof was completely re-covered which involved reslating and renewal of leadwork. Due to the topography inspection of the roof covering was restricted. It is complicated in design and incorporates wall head and valley gutters and some flat sections, all of which are finished in lead.</p> <p>There are no accessible roof space areas. There is a void above the tower room but the hatch is more than three metres above floor level. The other roof space areas can only be accessed from the roof as there are no internal hatches. Consequently roof timbers have not been examined.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p>
<b>Rainwater fittings</b>	<p>Gutters are of wall head and valley type and where visible are lined with good quality lead. The majority of downpipes are cast iron.</p> <p>Visually inspected with the aid of binoculars where required.</p>
<b>Main walls</b>	The outer walls are of sandstone and have an overall thickness of about 600mm.


	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
<b>Windows, external doors and joinery</b>	<p>The windows are timber framed, single glazed principally of sash and case style. They are of varying age.</p> <p>In the tower room the windows are timber framed single glazed side hung units.</p> <p>External doors are timber.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p>
<b>External decorations</b>	<p>The external woodwork and ironwork are painted.</p> <p>Visually inspected.</p>
<b>Conservatories / porches</b>	None.
<b>Communal areas</b>	None.
<b>Garages and permanent outbuildings</b>	<p>There is a detached single car rendered brick garage with a pitched roof overlaid with Rosemary tiles. There is a small basement store at the rear of the garage accessed from a separate external door.</p> <p>Visually inspected.</p>
<b>Outside areas and boundaries</b>	<p>The property has garden grounds which are enclosed with fences, hedges and walls.</p> <p>Visually inspected.</p>
<b>Ceilings</b>	<p>Ceilings are partly strapped and plastered and partly of plasterboard.</p> <p>There is some ornate cornicing in places.</p> <p>Visually inspected from floor level.</p>
<b>Internal walls</b>	<p>Internal walls are partly hard plastered, partly strapped and plastered and partly finished in plasterboard.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for</p>

	dampness where considered appropriate.
<b>Floors including sub floors</b>	<p>The majority of floors in the house are of suspended timber, overlaid with tongue and groove boarding. Some of the flooring in the basement is of concrete. Inspection of floor surfaces was restricted in places by floor coverings.</p> <p>There is no accessible under floor area.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>
<b>Internal joinery and kitchen fittings</b>	<p>There are a considerable number of high quality internal joinery finishes in the house.</p> <p>Woodwork is of mixed age. In the main house in the kitchen there is a sink unit and there are storage units.</p> <p>The kitchen fittings in the basement flat are of a modern type.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
<b>Chimney breasts and fireplaces</b>	<p>There is a solid fuel fire at the fireplace in the sitting room. There are gas fires in the study, dining room, bedroom one and bedroom two. There are open fireplaces in bedrooms three and four although neither were in use at the time of inspection.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
<b>Internal decorations</b>	<p>Walls and ceilings are papered and painted and in the entrance hall and first floor landing there is an ornate frieze on the lower sections of the walls.</p> <p>Visually inspected.</p>
<b>Cellars</b>	There are none.
<b>Electricity</b>	<p>Electricity is from mains supply. The distribution board for the main part of the house is located in a cupboard in the inner hallway.</p> <p>The distribution board for the basement flat is located in the cupboard off the vestibule.</p> <p>Accessible parts of the wiring were visually inspected</p>

	<p>without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<b>Gas</b>	<p>Gas is from mains supply. There are separate gas meters for the two parts of the property and they are located outside the house, at the left hand gable near to the front corner.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<b>Water, plumbing and bathroom fittings</b>	<p>Water is from public supply. In the cupboard off the vestibule in the basement flat the rising main is visible and this is lead. Elsewhere in the property plumbing is copper, plastic and steel.</p> <p>In the main house, in the bathroom, there are antique fittings including a mixer shower over the bath. There is a two piece suite in the first floor shower room and a two piece suite in the ground floor w.c apartment.</p> <p>In the basement flat there is a five piece suite.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<b>Heating and hot water</b>	<p>There is a partial gas fired central heating system in the main house with the Potterton boiler located in a cupboard off the entrance hall. Hot water is believed to be principally from the boiler with a back up electric immersion heater. There is a foam insulated hot water storage tank in a cupboard in the utility room.</p> <p>At basement level there is a Worcester combination boiler with radiators in all of the apartments. Hot water here is from the boiler.</p> <p>Accessible parts of the system were visually inspected apart</p>

	<p>from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<b>Drainage</b>	<p>Drainage is assumed to mains sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>
<b>Fire, smoke and burglar alarms</b>	<p>There are smoke alarms and there is a burglar alarm.</p> <p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<b>Any additional limits to inspection</b>	<p><i>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</i></p>

## Sectional Diagram showing elements of a typical house

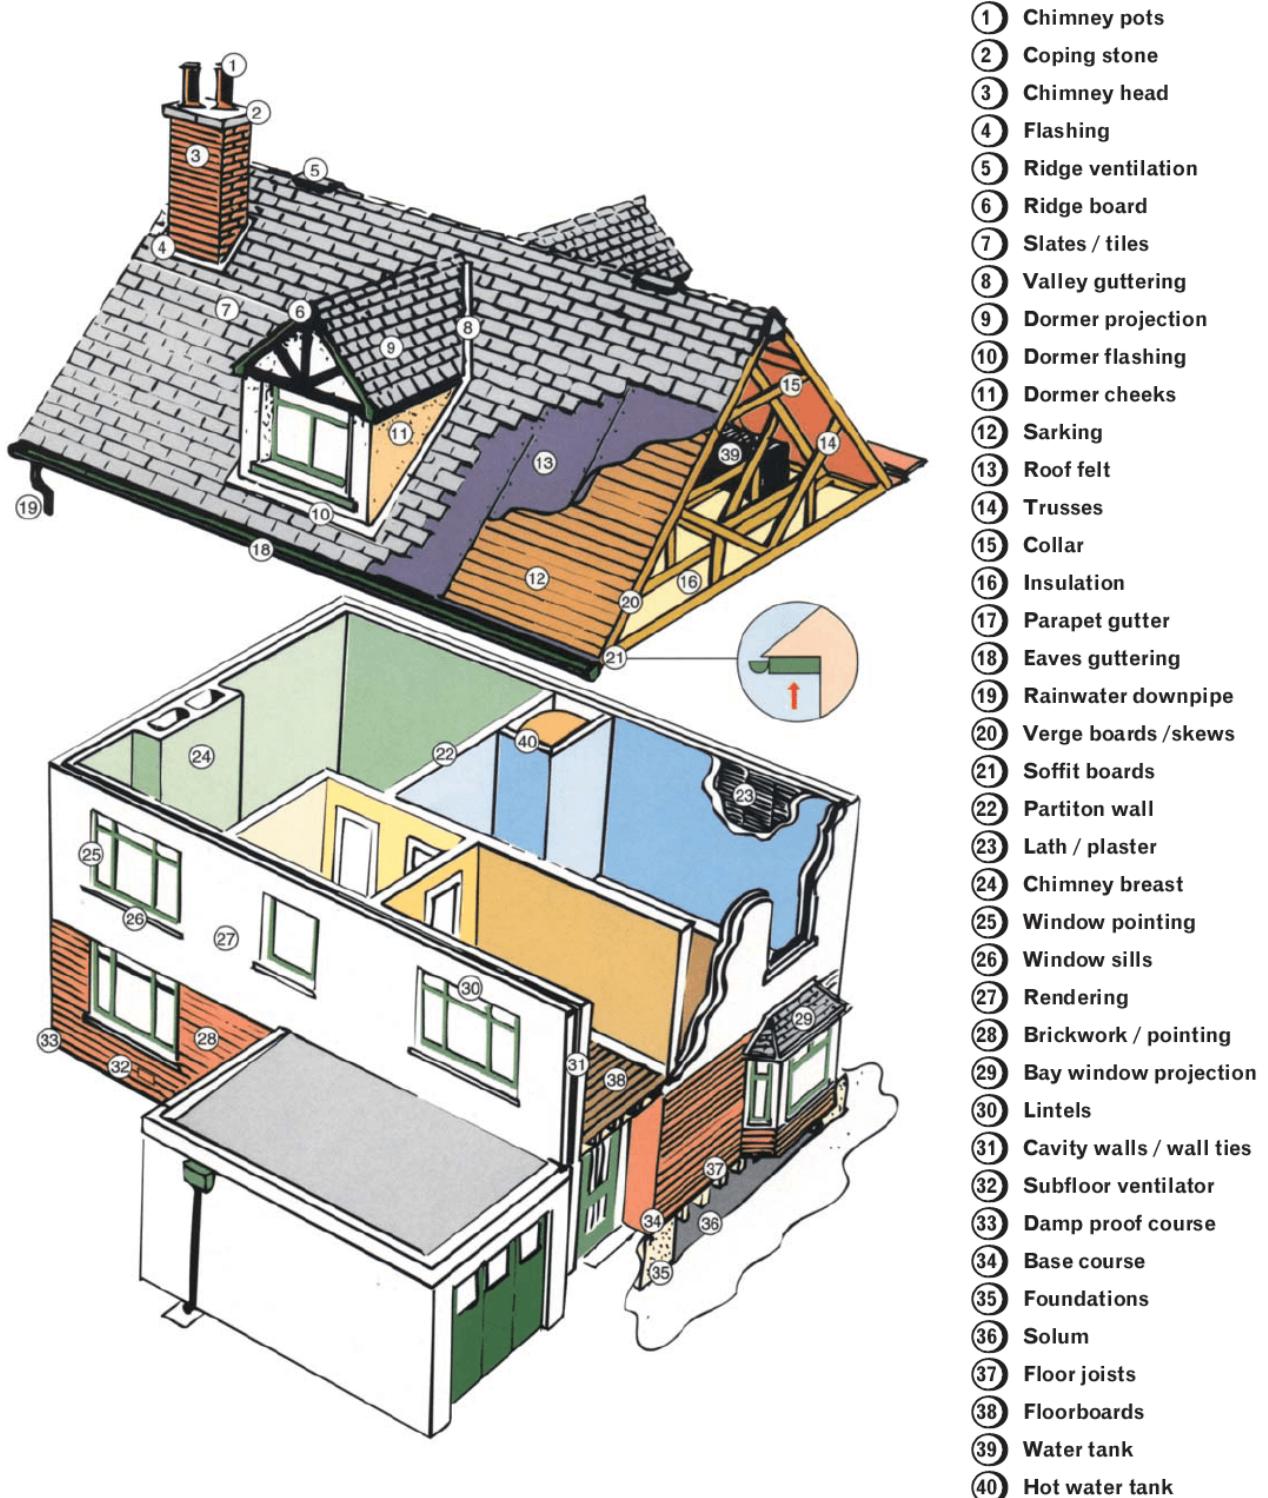

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	
Notes:	The house is affected by some past structural movement. This is noticeable externally where stonework is slightly distorted in places and there is a localised deflection in the rear wall towards first floor level. Internally there is some plaster cracking in places. There is no evidence of recent movement having occurred and the likelihood of further movement now seems remote. No structural repairs are considered necessary.

Dampness, rot and infestation	
Repair category:	
Notes:	<p>About 22 years ago the property was comprehensively repaired by the vendors and this involved the eradication of rot and dampness. Any guarantees that might be available in respect of that work should be made available to the purchaser. From a surface inspection no significant rot or infestation was noted in any parts of the property although the condition of hidden elements is not known.</p> <p>In the basement flat, in the entrance hall, near to the boxroom, there is evidence of staining on plasterwork which was damp when tested with an electronic moisture meter. The vendor states that a previous report has been prepared by Peter Cox, a specialist contractor, who confirmed that there is no rising dampness in the flat. The area should be carefully monitored. The stained plasterwork is unsightly, may be contaminated and eventually some replacement may be required. Peter Cox is revisiting the property</p>

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	<p>on 22 April 2021 and will produce an updated report.</p> <p>The front walls of the basement flat, in the kitchen, utility room and bathroom are built below external ground level and it is assumed that all necessary damp proofing measures have been introduced. Moisture meter tests on those walls revealed nothing adverse.</p>
--	--

Chimney stacks	
Repair category:	2
Notes:	The stonework of the chimney stacks is slightly worn in places and some parts of the chimneys are off plumb. They should be monitored and in time some repair is likely to be required.

Roofing including roof space	
Repair category:	2
Notes:	<p>Although no obvious significant defects were noted to the roof covering it is of complicated design and should be carefully maintained. Best practice would be to employ the services of a roofing contractor to inspect the roof covering on a regular basis, at least once a year.</p> <p>As stated above, the roof frame incorporates valley and parapet gutters and this type of roofing detail can often be troublesome as water becomes trapped. The gutters should be cleaned out on a regular basis.</p>

Rainwater fittings	
Repair category:	2

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	The cast iron elements are corroded in places and will require to be carefully maintained.
--------	--

Main walls	
Repair category:	
Notes:	<p>Although no obvious significant defects were noted to the outer walls at the time of inspection it was noted stonework is worn and weathered in places and with the action of the weather further deterioration will occur. The need for future repair should be expected.</p> <p>There is some ivy and other vegetation growing on parts of the outer walls and this should be carefully controlled.</p>

Windows, external doors and joinery	
Repair category:	
Notes:	<p>The windows are of varying age and some have been overhauled in the past. The sashes in the tower room are worn and there are some gaps which should be attended to. The need for regular maintenance should be expected.</p>

External decorations	
Repair category:	
Notes:	No obvious significant defects were noted to external decorations.

Conservatories / porches
--------------------------

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	Not applicable.

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings	
Repair category:	2
Notes:	The roof covering of the garage is the original and there are a few broken and missing tiles. Internally there is some minor localised decay at some of the roof timbers most noticeable at the rear of the garage where the frame abuts the brickwork of the outer walls. The concrete base is cracked and some corrosion was noted to the metal reinforcing rods of the floor of the garage which are visible in the basement store.

Outside areas and boundaries	
Repair category:	2
Notes:	The garden grounds are landscaped and well maintained. Parts of the stone boundary walls are worn and off-plumb and in time repair and renewal will be required.

Ceilings
----------

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	Although no obvious significant defects were noted to ceilings there is some cracking on some original surfaces. Strapped and plastered ceilings weaken with age and in time repair and renewal will be required.

Internal walls	
Repair category:	
Notes:	<p>As stated above, there is evidence of some localised dampness in the basement flat and eventually some repair will be required.</p> <p>Elsewhere in the property there is some cracking on some surfaces which will require attention before redecoration is carried out.</p>

Floors including sub-floors	
Repair category:	
Notes:	No obvious significant defects were noted to floors although under foot there are some loose boards and some of the visible floorboards are damaged reflecting typical wear and tear. Part of the vestibule floor is slightly off level.

Internal joinery and kitchen fittings	
Repair category:	
Notes:	No obvious significant defects were noted to internal joinery and there are some feature finishes in the house. Fittings in the main kitchen are affected by some wear and tear.

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

## Chimney breasts and fireplaces

Repair category:	<span>1</span>
Notes:	None of the fires have been tested and it is assumed that all of the flues linings are in satisfactory condition. Moisture meter tests on chimney breasts reveal no dampness.

## Internal decorations

Repair category:	<span>1</span>
Notes:	Although no obvious significant defects were noted to internal decorations, it is anticipated that purchasers would carry out some selective redecoration to their own taste.

## Cellars

Repair category:	
Notes:	Not applicable.

## Electricity

Repair category:	<span>1</span>
Notes:	Some of the power outlets are located in skirtings. Both the distribution boards are of a modern type. The systems should be tested by a Select registered contractor to ensure they are safe and comply with current regulations.

## Gas

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	All gas appliances and associated pipework should be tested for safety and thereafter regularly maintained by a Gas-Safe registered plumber.

Water, plumbing and bathroom fittings	
Repair category:	
Notes:	<p>No obvious significant defects were noted to the water or plumbing systems.</p> <p>Sanitary fittings are of varying age and some purchasers may consider replacing some of them.</p>

Heating and hot water	
Repair category:	
Notes:	<p>There is only a partial heating system in the main house and the boiler is of an older type. Neither system has been tested.</p>

Drainage	
Repair category:	
Notes:	<p>No obvious significant defects were noted to the drainage system which has not been tested.</p>

# survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

<b>Structural movement</b>	1
<b>Dampness, rot and infestation</b>	2
<b>Chimney stacks</b>	2
<b>Roofing including roof space</b>	2
<b>Rainwater fittings</b>	2
<b>Main walls</b>	1
<b>Windows, external doors and joinery</b>	2
<b>External decorations</b>	1
Conservatories / porches	
Communal areas	
<b>Garages and permanent outbuildings</b>	2
<b>Outside areas and boundaries</b>	2
<b>Ceilings</b>	1
<b>Internal walls</b>	2
<b>Floors including sub-floors</b>	1
<b>Internal joinery and kitchen fittings</b>	1
<b>Chimney breasts and fireplaces</b>	1
<b>Internal decorations</b>	1
Cellars	
<b>Electricity</b>	1
<b>Gas</b>	1
<b>Water, plumbing and bathroom fittings</b>	1
<b>Heating and hot water</b>	2
<b>Drainage</b>	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

**Three steps or fewer to a main entrance door of the property:** In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

**Unrestricted parking within 25 metres:** For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	[ ]YES [x]NO
3. Is there a lift to the main entrance door of the property?	[ ]YES [x]NO
4. Are all door openings greater than 750mm?	[ ]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES [ ]NO
6. Is there a toilet on the same level as a bedroom?	[x]YES [ ]NO
7. Are all rooms on the same level with no internal steps or stairs?	[ ]YES [x]NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES [ ]NO

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

<b>Matters for a solicitor or licensed conveyancer</b>	
The property is located in a conservation area and is listed Grade B, being of architectural and historic interest. The listing covers the house, the gate pillars and also the boundary walls. Some of the boundary walls are located in the Botanic Gardens and the title deeds should be referred to, to establish responsibility for the upkeep of these walls which may be in shared ownership.	
<b>Estimated re-instatement cost (£) for insurance purposes</b>	
£2,000,000. It is recommended that specialist advice is obtained from a building surveyor or quantity surveyor as the property is listed Grade B.	
<b>Valuation (£) and market comments</b>	
The market value of the property in its present condition and with vacant possession is £1,200,000 (ONE MILLION TWO HUNDRED THOUSAND POUNDS).	
<b>Report author:</b>	Hugh G Campbell, Bsc FRICS
<b>Company name:</b>	Glasgow North - Allied Surveyors Scotland Plc
<b>Address:</b>	Herbert House 24 Herbert Street Glasgow G20 6NB
<b>Signed:</b>	Electronically Signed: 179932-16245034-6E8D
<b>Date of report:</b>	08/04/2021

P A R T   2 .

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.



## Mortgage Valuation Report

Property:	Lismore House 115 Kelvin Drive Glasgow G20 8QL	Client: Mr. Ian & Mrs Valerie Atkinson  Tenure: Ownership
Date of Inspection:	07/04/2021	Reference: GE/6800/HGC/AS

*This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

1.0 LOCATION	
The property is located in the North Kelvinside district of Glasgow, lying to the north west of the city centre, on the edge of the Botanic Gardens in Glasgow. The surrounding area is developed with residential property of varying age and character. The property is very conveniently situated for all west end facilities include Byres Road and Glasgow University.	
2.0 DESCRIPTION	2.1 Age:
Detached house, two storey and basement in height with a tower room.	The property was built in 1860.
3.0 CONSTRUCTION	
Outer walls: Sandstone.  Roof: Multi pitched principally slated with leaded sections.	
4.0 ACCOMMODATION	
Ground floor: vestibule, entrance hall, sitting room (rear and side), study (front), dining room (front), inner hallway leading to kitchen (rear), with utility room off (rear), w.c apartment (side) off inner hall.  First floor: bedroom 1 (rear and side), bedroom 2 (rear) currently used as office, bedroom 3 (front), bedroom 4 (front), bathroom (rear), shower apartment (front).  Second floor: tower room accessed from staircase at first floor landing and currently used as artists studio.  Basement: self contained flat accessed from external door at left hand gable and also with an internal door connection	

to the main house; vestibule with cupboard off, entrance hall with boxroom off, lounge (rear), bedroom 1 (rear), bedroom 2 (rear), bedroom 3 (rear), kitchen (side), bathroom (internal).

<b>5.0</b>	<b>SERVICES (No tests have been applied to any of the services)</b>						
<b>Water:</b>	Mains	<b>Electricity:</b>	Mains	<b>Gas:</b>	Mains	<b>Drainage:</b>	Mains
<b>Central Heating:</b>	Partial gas fired system in main house. Gas fired system in basement flat.						
<b>6.0</b>	<b>OUTBUILDINGS</b>						
<b>Garage:</b>	Detached single car rendered brick garage with pitched and tiled roof.						
<b>Others:</b>	Basement store below garage.						

This is a substantial detached villa which appears to have been adequately maintained having regard to its age and character.

The roof covering was completely renewed about 22 years ago but is of complicated design and should be carefully maintained. External stonework is worn and weathered in places and with the action of the weather further deterioration will occur. Some of the windows require a general overhaul.

Internally, at basement level, there are some traces of dampness in the entrance hall and these should be investigated and eliminated.

The building is affected by some structural movement. There is no evidence of recent movement having occurred and the likelihood of further movement seems remote. No structural repairs are considered necessary.

The roof covering of the garage is old and reaching the end of its useful economic life.

Some of the boundary walls are worn and off plumb and eventually some repair will be required.

<b>8.0</b>	<b>ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)</b>						
None							

<b>8.1 Retention recommended:</b>	Nil						
-----------------------------------	-----	--	--	--	--	--	--

<b>9.0</b>	<b>ROADS &amp;FOOTPATHS</b>						
------------	-----------------------------	--	--	--	--	--	--

Made up and adopted.

<b>10.0</b>	<b>BUILDINGS INSURANCE (£):</b>	2,000,000.	<b>GROSS EXTERNAL FLOOR AREA</b>	491	<b>Square metres</b>		
-------------	---------------------------------	------------	----------------------------------	-----	----------------------	--	--

	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>						
--	--	--	--	--	--	--	--

<b>11.0</b>	<b>GENERAL REMARKS</b>						
-------------	------------------------	--	--	--	--	--	--

The property is located in a conservation area and is listed Grade B, being of architectural and historic interest. The listing covers the house, the gate pillars and also the boundary walls. Some of the boundary walls are located in the

Botanic Gardens and the title deeds should be referred to, to establish responsibility for the upkeep of these walls which may be in shared ownership.

12.0	<b>VALUATION</b> On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.			
12.1	Market Value in present condition (£):	1,200,000.	ONE MILLION TWO HUNDRED THOUSAND POUNDS	
12.2	Market Value on completion of essential works (£):			
12.3	Suitable security for normal mortgage purposes?	Yes		
12.4	Date of Valuation:	07/04/2021		
Signature:		Electronically Signed: 179932-16245034-6E8D		
Surveyor:	Hugh G Campbell	Bsc FRICS	Date:	08/04/2021
<b>Glasgow North - Allied Surveyors Scotland Plc</b>				
Office:	Herbert House 24 Herbert Street Glasgow G20 6NB	Tel: 0141 337 1133 Fax: email: <a href="mailto:glasgow.north@alliedsurveyorsscotland.com">glasgow.north@alliedsurveyorsscotland.com</a>		

P A R T   3 .

# ENERGY REPORT

---

A report on the energy efficiency of the property.



# energy report

energy report on:

<b>Property address</b>	Lismore House 115 Kelvin Drive Glasgow G20 8QL
<b>Customer</b>	Mr. Ian & Mrs Valerie Atkinson
<b>Customer address</b>	Lismore House 115 Kelvin Drive Glasgow G20 8QL
<b>Prepared by</b>	Hugh G Campbell, Bsc FRICS Glasgow North - Allied Surveyors Scotland Plc

# Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 1 , 115 KELVIN DRIVE, GLASGOW, G20 8QL

**Dwelling type:** Detached house  
**Date of assessment:** 07 April 2021  
**Date of certificate:** 08 April 2021  
**Total floor area:** 409 m<sup>2</sup>  
**Primary Energy Indicator:** 360 kWh/m<sup>2</sup>/year


**Reference number:** 1802-0431-3522-2408-1493  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£14,682	See your recommendations report for more information
Over 3 years you could save*	£6,705	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

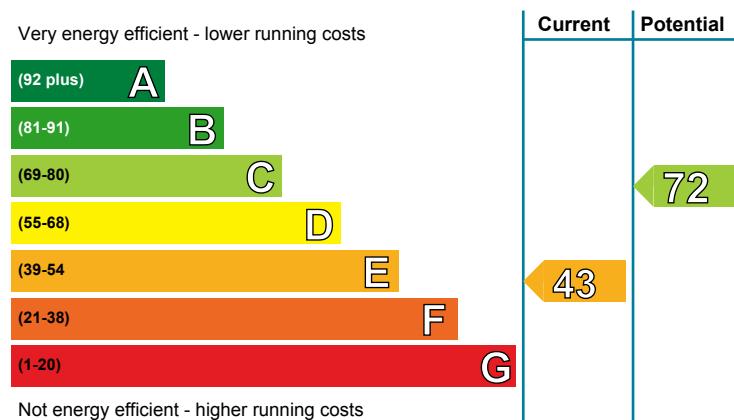


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (43)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

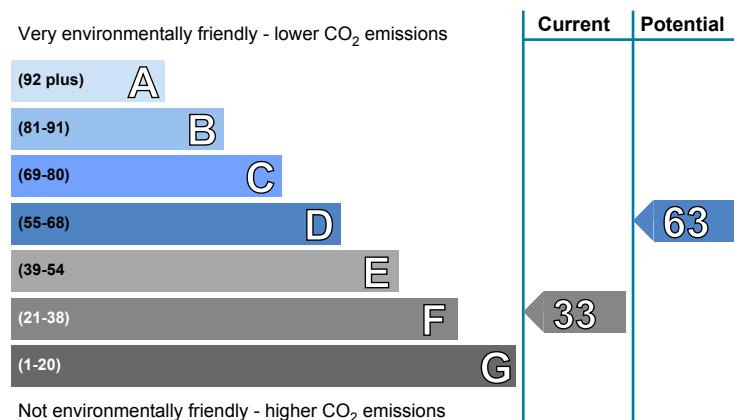

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (33)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£3966.00
2 Floor insulation (suspended floor)	£800 - £1,200	£801.00
3 Draughtproofing	£80 - £120	£654.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★★
Floor	Suspended, no insulation (assumed)	—	—
Windows	Single glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, mains gas Boiler and radiators, mains gas	★★★★☆ ★★★★☆	★★★★★ ★★★★★
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★★
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★★
Lighting	Low energy lighting in 85% of fixed outlets	★★★★★	★★★★★

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 64 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 26 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 13 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£13,650 over 3 years	£7,011 over 3 years	
Hot water	£447 over 3 years	£366 over 3 years	
Lighting	£585 over 3 years	£600 over 3 years	
<b>Totals</b>	<b>£14,682</b>	<b>£7,977</b>	 You could save £6,705 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£1322	D 59	E 46
2 Floor insulation (suspended floor)	£800 - £1,200	£267	D 62	E 50
3 Draughtproofing	£80 - £120	£218	D 65	E 53
4 Replace boiler with new condensing boiler	£2,200 - £3,000	£175	D 67	D 56
5 Secondary glazing to single glazed windows	£1,000 - £1,500	£253	C 69	D 60
6 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£309	C 72	D 63

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

### 4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 5 Secondary glazing

Secondary glazing is the addition of a second pane of glass inside the existing window. Adding secondary glazing will improve comfort in the home by reducing draughts and cold spots near windows. It may also reduce noise and combat problems with condensation. Installation can be carried out by a competent DIY enthusiast. Building regulations may apply to this work, so it is best to check with your local authority building standards department.

### 6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	71,166	N/A	N/A	(21,419)
Water heating (kWh per year)	2,908			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Grant Robertson
Assessor membership number:	EES/008401
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	24 Herbert Street Glasgow G20 6NB
Phone number:	01413309950
Email address:	<a href="mailto:glasgow.north@alliedsurveyorsscotland.com">glasgow.north@alliedsurveyorsscotland.com</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T   4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



# Property Questionnaire

Property Address

Lismore House  
115 Kelvin Drive  
Glasgow  
G20 8QL

Seller(s)

Ian & Mrs Valerie Atkinson

Completion date of property questionnaire

13/04/2021

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<b>How long have you owned the property?</b> 25 years
<b>2.</b>	<b>Council tax</b>
	<b>Which Council Tax band is your property in? (Please circle)</b> [ ]A [ ]B [ ]C [ ]D [ ]E [ ]F [x]G [ ]H
<b>3.</b>	<b>Parking</b>
	<b>What are the arrangements for parking at your property? (Please tick all that apply)</b> <p>Garage [x]            Allocated parking space [ ]            Driveway [x]            Shared parking [ ]            On street [x]            Resident permit [ ]            Metered parking [ ]            Other (please specify):</p>

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[x]YES [ ]NO [ ]Don't know
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[x]YES [ ]NO
<b>6.</b>	<b>Alterations/additions/extensions</b>	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  <i>Cupboard on 1st Floor converted into shower room</i>	[x]YES [ ]NO
	If you have answered yes, please describe below the changes which you have made:  <i>Cupboard on 1st Floor converted into shower room</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[x]YES [ ]NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:  <i>Documents in sellers possession</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[ ]YES [x]NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[ ]YES [ ]NO
	(ii) Did this work involve any changes to the window or door openings?	[ ]YES [ ]NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	

# property questionnaire

	Please give any guarantees which you received for this work to your solicitor or estate agent.	
<b>7.</b>	<b>Central heating</b>	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[ ]YES [ ]NO <input checked="" type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).  <i>Gas Boiler</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?  <i>Central heating in place when we bought the house 25 years ago. Boiler replaced approx. 6 years ago, and a maintenance contract is in force</i>	
	(ii) Do you have a maintenance contract for the central heating system?  <i>Home Response Direct</i>	[x]YES [ ]NO
	If you have answered yes, please give details of the company with which you have a maintenance contract  <i>Home Response Direct</i>	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).  <i>October 2020</i>	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x]YES [ ]NO
<b>9.</b>	<b>Issues that may have affected your property</b>	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[ ]YES [x]NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[ ]YES [ ]NO
	Are you aware of the existence of asbestos in your property?	[ ]YES [x]NO

# property questionnaire

b			<input type="checkbox"/> Don't know																								
	If you have answered yes, please give details:																										
<b>10. Services</b>																											
a	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>Y</td> <td>SSE</td> </tr> <tr> <td>Water mains or private water supply</td> <td>Y</td> <td>Scottish Water</td> </tr> <tr> <td>Electricity</td> <td>Y</td> <td>SSE (Eon for basement flat)</td> </tr> <tr> <td>Mains drainage</td> <td>Y</td> <td>Scottish Water</td> </tr> <tr> <td>Telephone</td> <td>Y</td> <td>BT</td> </tr> <tr> <td>Cable TV or satellite</td> <td>Y</td> <td>SKY</td> </tr> <tr> <td>Broadband</td> <td>Y</td> <td>BT</td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas or liquid petroleum gas	Y	SSE	Water mains or private water supply	Y	Scottish Water	Electricity	Y	SSE (Eon for basement flat)	Mains drainage	Y	Scottish Water	Telephone	Y	BT	Cable TV or satellite	Y	SKY	Broadband	Y	BT
Services	Connected	Supplier																									
Gas or liquid petroleum gas	Y	SSE																									
Water mains or private water supply	Y	Scottish Water																									
Electricity	Y	SSE (Eon for basement flat)																									
Mains drainage	Y	Scottish Water																									
Telephone	Y	BT																									
Cable TV or satellite	Y	SKY																									
Broadband	Y	BT																									
b	Is there a septic tank system at your property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO																								
	If you have answered yes, please answer the two questions below:																										
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know																								
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract:																										
<b>11. Responsibilities for shared or common areas</b>																											
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know																								
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> N/A																								

# property questionnaire

c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
<b>12.</b>	<b>Charges associated with your property</b>	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
<b>13.</b>	<b>Specialist works</b>	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.  <i>Dry Rot - We engaged an architect and were supported by Historic Scotland to oversee the eradication. This work was carried out around 22 to 24 years ago.</i>	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

# property questionnaire

	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[ ]YES [x]NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

<b>14.</b>	<b>Guarantees</b>	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(ii)	Roofing	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(iii)	Central heating	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(iv)	National House Building Council(NHBC)	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(v)	Damp course	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[x]NO [ ]YES [ ]Don't know [ ]With title deeds [ ]Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	[ ]YES [x]NO
	If you have answered yes, please give details:	

<b>15.</b>	<b>Boundaries</b>
------------	-------------------

# property questionnaire

	So far as you are aware, has any boundary of your property been moved in the last 10 years?	[ ]YES [x]NO [ ]Don't know
	If you have answered yes, please give details:	
<b>16.</b>	<b>Notices that affect your property</b>	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	[ ]YES [x]NO
b	that affects your property in some other way?	[ ]YES [x]NO
c	that requires you to do any maintenance, repairs or improvements to your property?	[ ]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

**Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

Signature(s):	Ian & Mrs Valerie Atkinson
Capacity:	[x]Owner [ ]Legally Appointed Agent for Owner
Date:	13/04/2021